

Manhole Inspection Summary

Manhole # S35G__071MH

Printed On: 3/20/2009

Page 1 of 5

Inspection ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **35G** Node: **071** Status: **Found**

Insp Date: 1/15/09 9:12 AM

Incomplete Comments

Crew: **cb**
Inspector: **jjoirer**
Firm: **ATS**

Location Address: **37 s charles st**

Cross Street: **e lombard st**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **32** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

Chimney / Frame Adjustment

☒ Exists

Material: **Brick and Concrete**

☐ Parged

Height: **10** (in.)

Condition: ☐ Sound

☐ Cracked

☐ Root Intrusion

☒ **Loose Brick**

☒ **Deteriorated**

Infiltration: ☒ None

☐ Joint

☐ Cracks

☐ Mortar

☐ Roots

☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☐ Sound

☒ **Cracked**

☐ Root Intrusion

☐ Loose Brick

☐ Deteriorated

Infiltration: ☐ None

☐ Joint

☐ Cracks

☒ **Mortar**

☐ Roots

☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: **0** (in.)

Condition: ☐ Sound

☒ **Cracked**

☐ Root Intrusion

☐ Loose Brick

☐ Deteriorated

Infiltration: ☒ None

☐ Joint

☐ Cracks

☐ Mortar

☐ Roots

☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Deteriorated

☐ Leaks

☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open**

Junc Dist: **0**

nearest .5 ft.

Azimuth: **0**

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Deteriorated

☐ Leaks

☐ Debris

Steps

Count: **10** Missing: **0**

☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge

Depth: **0** (ft.)

☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S35G__071MH


Printed On: 3/20/2009

Page 2 of 5

Location View



Top View

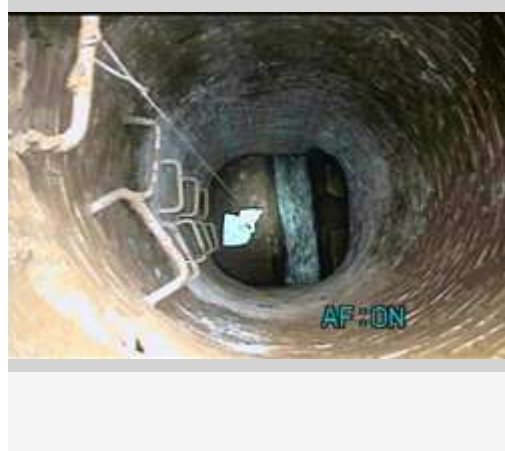

MISC



bench debris

Defect 5



corbal cracked, infiltration mortar

Defect 4



frame leaks, chimney loose bricks, deteriorated

Defect 2



cracked barrel

Defect 1



corr steps

Manhole Inspection Summary

Manhole # S35G__071MH

Printed On: 3/20/2009

Page 4 of 5

21 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: 17.25 (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

12 in. Circular Gravity Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: 16.75 (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S35G__071MH

Printed On: 3/20/2009

Page 5 of 5

21 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock



cracked top

Pipe Height: **0** (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **17.16** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection